




SOUTHEAST QUARTER
SECTION 1 T-20 R-19
TROY TOWNSHIP
RICHLAND COUNTY
OHIO

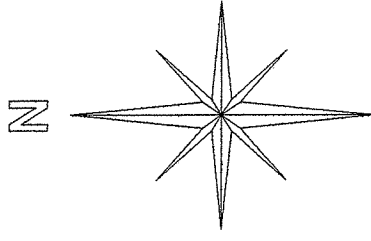

NEW SPLIT
RICHLAND COUNTY
TAX MAP OFFICE
EAK 2015
INITIAL DATE
HH-38


NEW SURVEY
OF EXISTING PARCEL
RICHLAND COUNTY
TAX MAP OFFICE
EAK 2015
INITIAL DATE

BASIS OF BEARINGS:
SURVEY INDEX: "H" PAGE 307

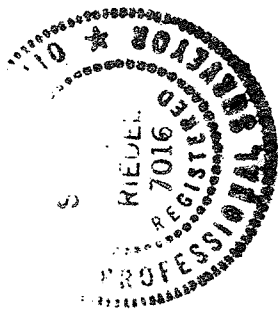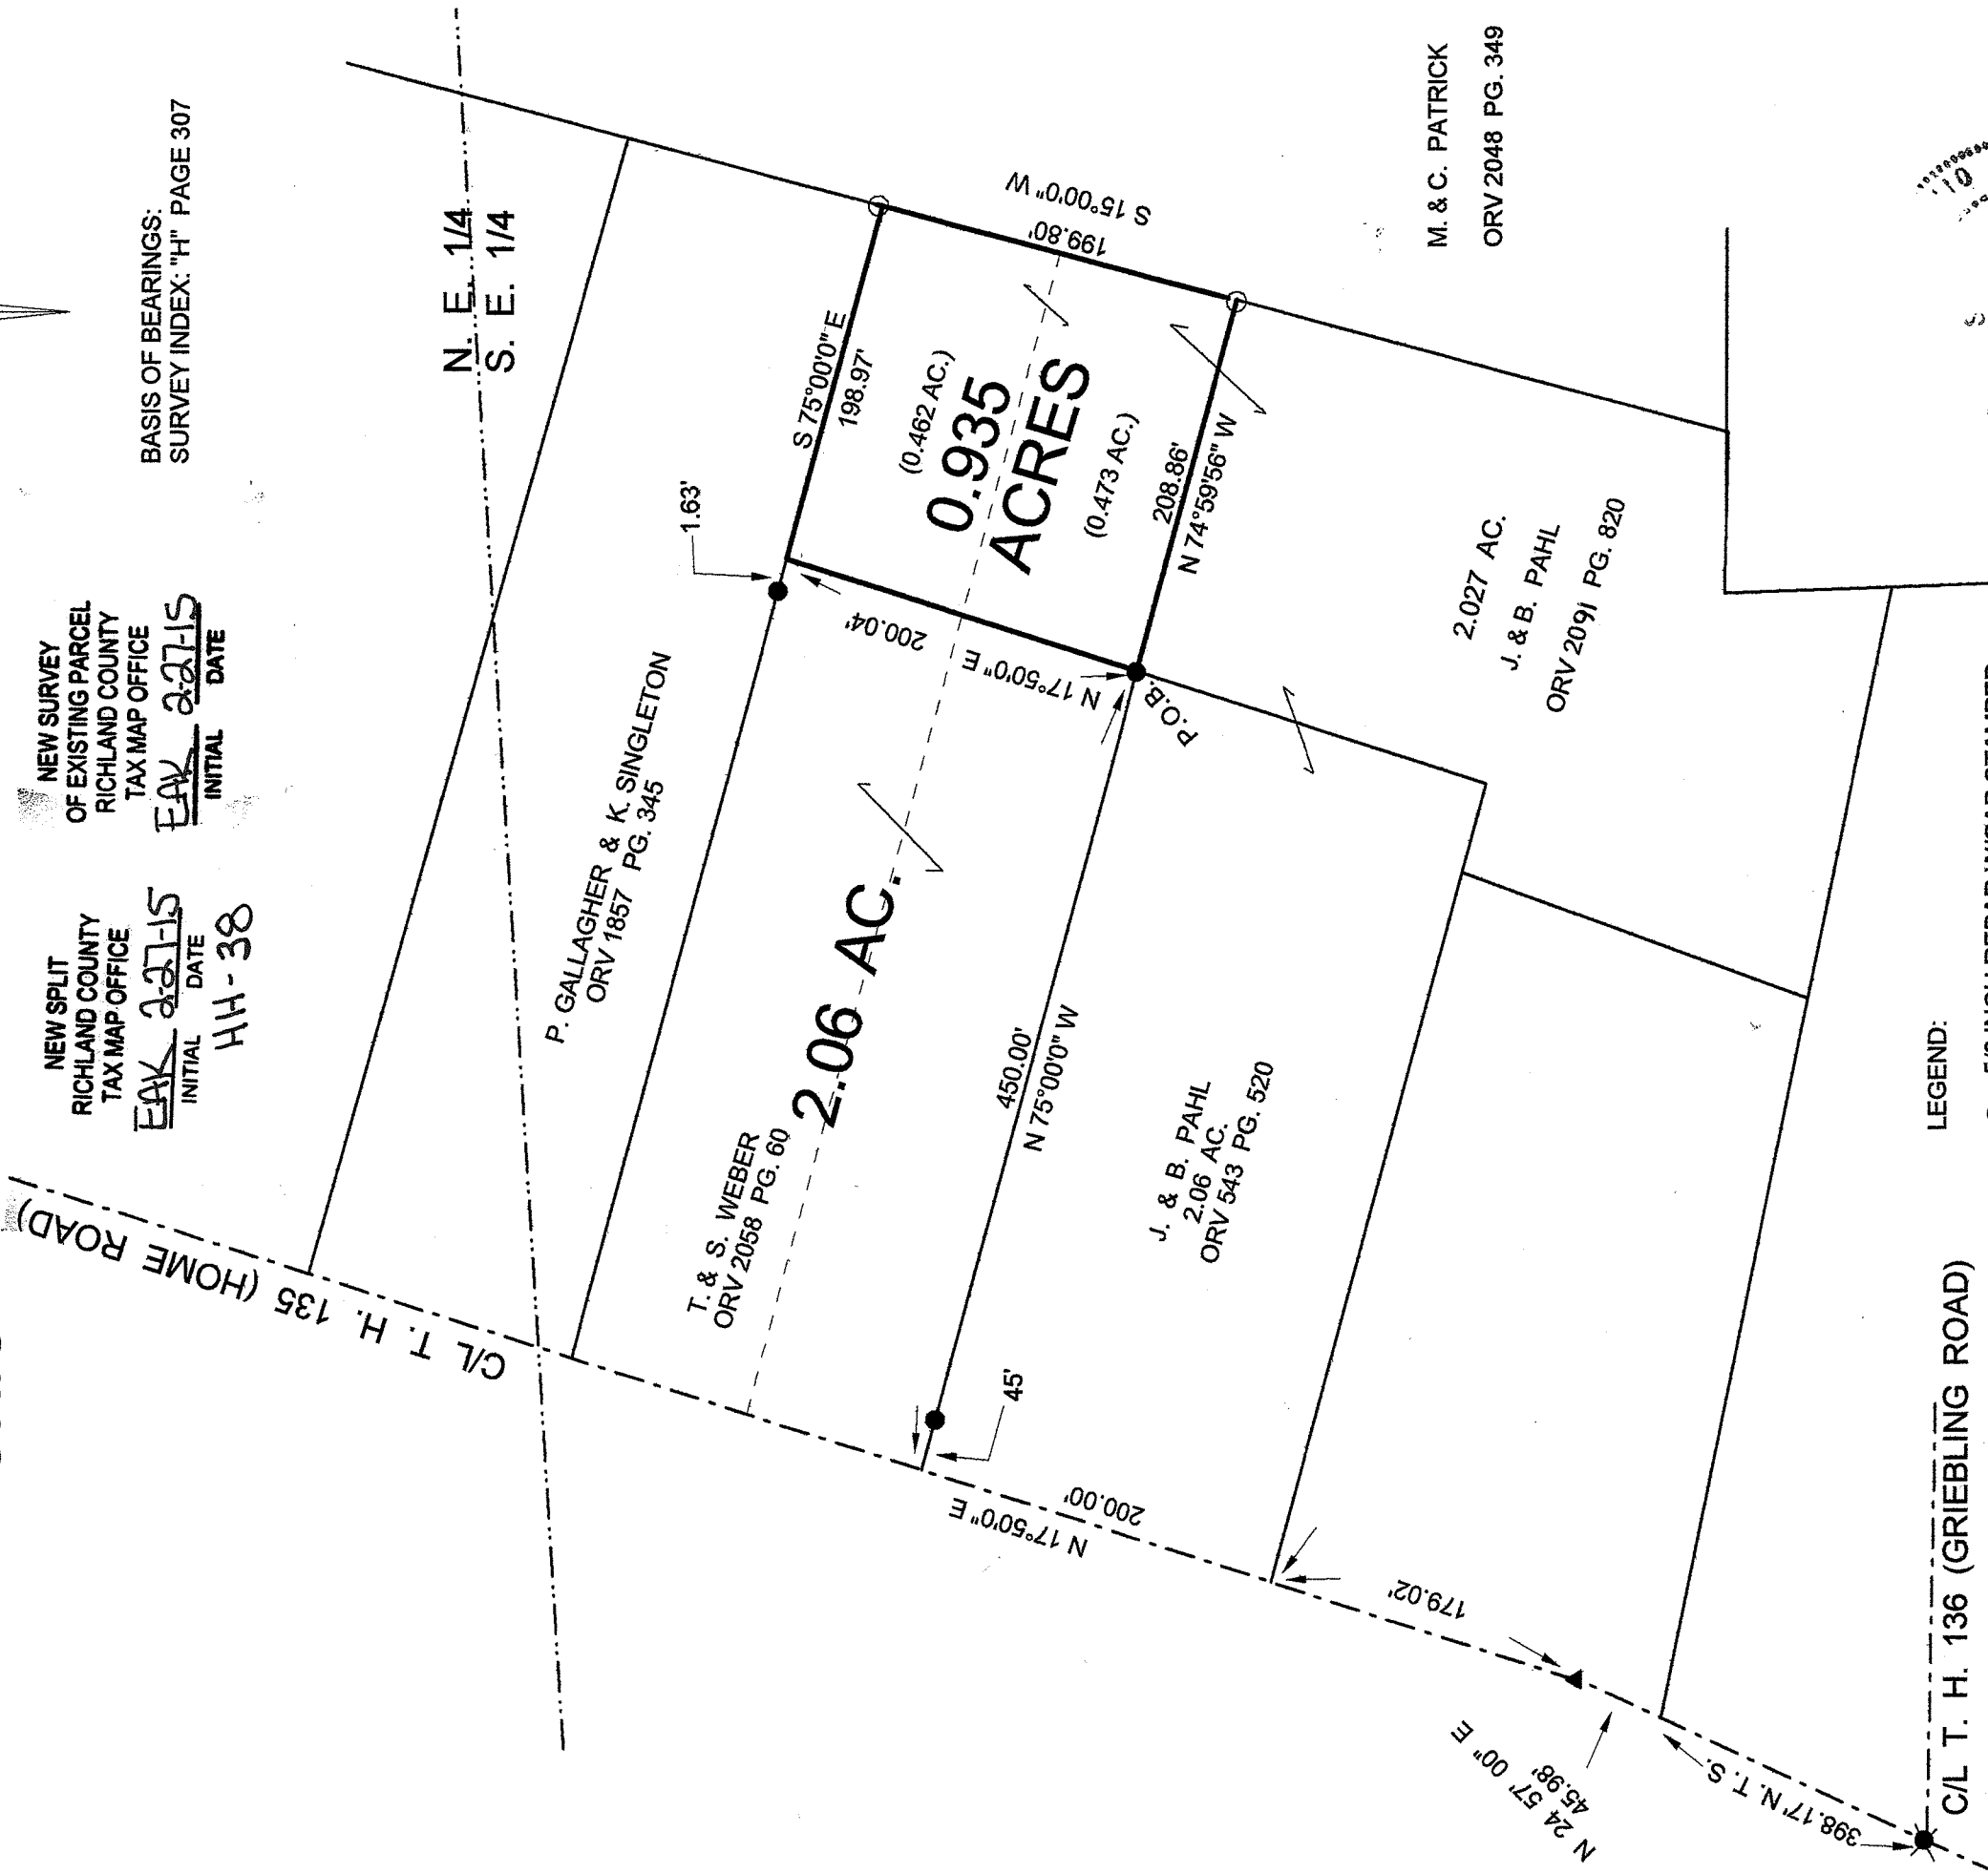


- LEGEND:
- - 5/8 INCH REBAR W/CAP STAMPED "PS 7016" SET
 - - EXISTING IRON PIN
 - ▲ - EXISTING SURVEY NAIL
 - ⦿ - EXISTING RAILROAD SPIKE

The 0.935 acre parcel of land shown on this plat does not constitute a principal building site and will not be conveyed by said grantee, heirs and assigns, independent from any adjoining or contiguous parcel.

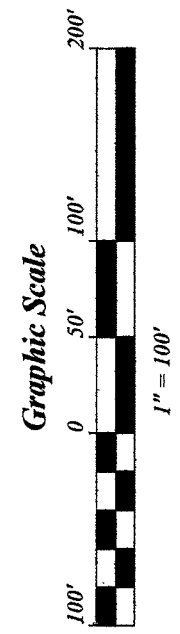

(Signature)

STEVEN H. RIEDEL
OHIO SURVEYOR 7016
FEBRUARY 25, 2015
RTR1SEC

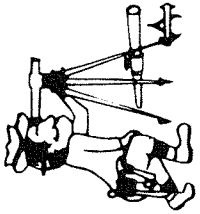

Riedel Land Surveying Company

712 N. Henry St.
Crestline, Ohio 44827

Phone (419) 683-1951

February 25, 2015

T. Pahl Property (0.935 acres)
Rtr1sec

Revised: February 27, 2015

Situated in the Township of Troy, County of Richland, State of Ohio and being part of the Southeast quarter of Section 1, T-20, R-19, and being more fully described as follows:

Commencing at an existing railroad spike at the intersection of the centerline of Township Highway 136 (Griebling Road) with the centerline of Township Highway 135 (HomeRoad);

thence running North 24 deg. 57 min. 00 sec. East along the centerline of Township Highway 135 for 444.15 feet to an existing survey nail;

thence turning and running North 17 deg. 50 min. 00 sec. East along said centerline for 379.02 feet;

thence turning and running South 75 deg. 00 min. 00 sec. East (passing an existing iron pin at 45.00 feet) for a total distance of 450.00 feet to an existing iron pin and the place of beginning;

thence turning and running North 17 deg. 50 min. 00 sec. East for 200.04 feet (an existing iron pin being North 75 deg. 00 min. 00 sec. West and 1.63 feet from this point);


thence turning and running South 75 deg. 00 min. 00 sec. East for 198.97 feet to a 5/8 inch rebar set;

thence turning and running South 15 deg. 00 min. 00 sec. West for 199.80 feet to a 5/8 inch rebar set;

thence turning and running North 74 deg. 59 min. 56 sec. West for 208.86 feet to the place of beginning.

The grantees, their heirs and assigns do hereby covenant and agree that the parcel of land described in this instrument or any portion thereof does not constitute a principal building site under applicable zoning and will not be conveyed by said grantee, heirs and assigns, independent from any adjoining or contiguous parcel.

All 5/8 inch rebars set have a plastic cap stamped "PS 7016".

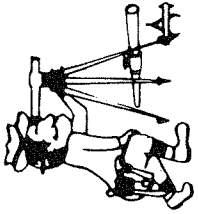

Riedel Land Surveying Company

712 N. Henry St.
Crestline, Ohio 44827

Phone (419) 683-1951

Page 02

T. Pahl Property continued (0.935 acres)
Rtr1sec

The above described parcel has a calculated area of 0.935acof land according to a survey made on February 25, 2015 by Steven H. Riedel, Ohio surveyor 7016.
Prior Deed: O. R. V. 363 page 564
Basis of bearings: Survey Index "H" page 307

NEW SPLIT
RICHLAND COUNTY
TAX MAP OFFICE

~~EAK~~ INITIAL
2-27-15 DATE

HH-38

NEW SURVEY
OF EXISTING PARCEL
RICHLAND COUNTY
TAX MAP OFFICE

~~EAK~~ INITIAL
2-27-15 DATE