


Q-187



NORTH

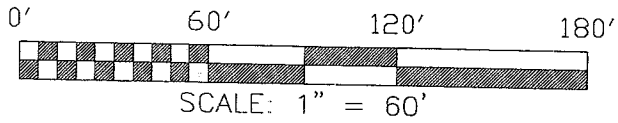

BEARINGS ARE BASED ON AN ASSUMED MERIDIAN

J. & A. HARING  
DEED VOLUME 689, PAGE 380

THE NE CORNER OF  
THE SW QTR. SEC. 32

THE PLACE OF  
BEGINNING

STATE ROUTE 97

N 08°30'07" W  
30.00'

REF=30'

S 88°13'28" E 672.81'

REF=35.26'

N 87°02'45" W 250.00'

G. & L. LOESCH  
O.R.V. 990, PAGE 709

N 10°04'04" W  
120.00'

J. & A. HARING  
TO  
G. & L. LOESCH

1.64 ACRES

C. W. DAILY  
DEED VOLUME 660, PAGE 36

N 87°36'22" W 398.56'

THE EAST LINE OF  
THE SW QTR. SEC. 32

S 00°17'39" E  
1335.31'


S 00°17'39" E 156.51'

LEGEND

- IRON PIN FOUND
- ⦿ MAG NAIL SPIKE FOUND
- ⊗ MAG NAIL SPIKE SET
- ⊗ IRON PIN SET WITH CAP STAMPED "SEILER 6869"

NEW SPLIT  
RICHLAND COUNTY  
TAX MAP OFFICE

INITIAL DATE  
H 10-1802  
Shirley Paves  
must transfer  
First

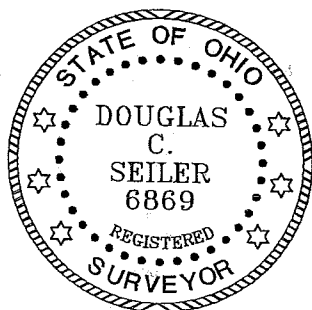

*Douglas C. Seiler* 10/16/02  
 SURVEYED BY: DOUGLAS C. SEILER  
 PROFESSIONAL SURVEYOR #6869  
 52-1/2 NORTH MAIN STREET  
 MANSFIELD, OHIO 44902  
 (419) 525-3644  
 FAX (419) 525-3696

SURVEY PLAT FOR  
HARING

PART SW QTR. SEC. 32, T-20, R-18  
VILLAGE OF BELLVILLE  
RICHLAND COUNTY, OHIO

DATE: SEPT. 9, 2002

SCALE: 1"=60'

HARING02

# Douglas C. Seiler

Professional Land Surveyor

52½ North Main • Mansfield, Ohio 44902  
(419) 525-3644 • FAX (419) 525-3696

## SURVEY DESCRIPTION

PART SW QUARTER SECTION 32  
VILLAGE OF BELLVILLE, OHIO

Situated in the Village of Bellville, County of Richland, State of Ohio and being a part of the Southwest Quarter of Section 32, Township 20 North, Range 18 West, more particularly described as follows:

Commencing at an iron pin found and accepted as marking the northeast corner of said quarter; Thence, South 00 degrees 17 minutes 39 seconds East with the east line of said quarter, a distance of 1335.31 feet to an iron pin found, the place of beginning of the parcel herein described;

Thence, continuing South 00 degrees 17 minutes 39 seconds East with said east line, a distance of 156.51 feet to an iron pin found;

Thence, North 87 degrees 36 minutes 22 seconds West a distance of 398.56 feet to an iron pin found;

Thence, North 10 degrees 04 minutes 04 seconds West a distance of 120.00 feet to an iron pin found;

Thence, North 87 degrees 02 minutes 45 seconds West, passing through an iron pin found for reference at 214.74 feet, a total distance of 250.00 feet to a Mag nail spike found on the centerline of State Route 97;

Thence, North 08 degrees 30 minutes 07 seconds West with said centerline, a distance of 30.00 feet to a Mag Nail spike found;

Thence, South 88 degrees 13 minutes 28 seconds East, passing through an iron pin found for reference at 30.00 feet, a total distance of 672.81 feet to the place of beginning, containing 1.64 acres, according to survey by Douglas C. Seiler, professional Surveyor #6869 on September 9, 2002, but subject to the right of way of State Route 97.

The grantee, his heirs and assigns do hereby covenant and agree that the parcel of land described by this instrument will not be conveyed by said grantee, heirs, or assigns independently from a contiguous parcel of land without the approval of the Village of Bellville Planning Commission.

Iron pins set are 5/8" rods with caps stamped "SEILER 6869".

Bearings are based on an assumed meridian and are intended to be used for angular determination only.

NEW SPLIT  
RICHLAND COUNTY  
TAX MAP OFFICE

INITIAL DCS DATE 10-18-02  
*Plus Parcel Must Show First*



Douglas C. Seiler  
Professional Surveyor #6869

Q-187

Q-187