


V-33



BEARINGS ARE BASED ON SURVEY F-3-408 ON FILE AT THE RICHLAND COUNTY TAX MAP OFFICE AND ARE INTENDED TO BE USED FOR ANGULAR DETERMINATION ONLY.

NORTH

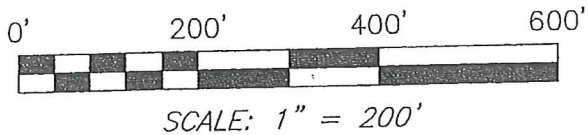

BUNKER HILL ROAD (C.B. 108)

THE FIRST CONGRESSIONAL CHURCH OF MANSFIELD (D.V. 560, PAGE: 280)

THE NORTH LINE OF THE SE QTR. SECTION 10

THE NE CORNER OF THE SE QTR. SECTION 10

THE PLACE OF BEGINNING

THE EAST LINE OF THE SE QTR. SECTION 10

REF=30.00' N 27°55'14" W 68.59'

S 88°56'36" E 1546.45'

2.11 ACRES

N 88°56'36" W 1514.88'

967.76' S 00°31'36" E

S 00°31'36" E 60.02'

MOHICAN SCHOOL (O.R.V. 206, PAGE: 325)

Replaced By Y-258

NEW SPLIT RICHLAND COUNTY TAX MAP OFFICE  
 mub 3-26-07  
 INITIAL DATE



- LEGEND**
- IRON PIN FOUND
  - △ RAILROAD SPIKE SET
  - ▲ RAILROAD SPIKE FOUND
  - ⊗ 5/8" IRON PIN SET WITH CAP STAMPED "SEILER AND CRAIG, INC."

SURVEY PLAT FOR	
PROPERTY TRANSFER	
PART SE QTR. SECTION 10, T-21, R-17	
WORTHINGTON TOWNSHIP	
RICHLAND COUNTY, OHIO	
DATE: MARCH 23, 2007	SCALE: 1"=200'
MOHICAN07.DWG/MOHICAN06.ASC	

SURVEY BY: *Chad F. Craig*  
 CHAD F. CRAIG PS. #8195  
 for SEILER & CRAIG SURVEYING INC.  
 52-1/2 NORTH MAIN STREET  
 MANSFIELD, OHIO 44902  
 (419) 525-3644  
 FAX (419) 525-3696

**SEILER & CRAIG SURVEYING, INC.**

Douglas C. Seiler, PS & Chad F. Craig, PS  
52 1/2 North Main Street  
Mansfield, Ohio 44902  
419-525-3644 Fax 419-525-3696  
www.seilerandcraig.com

**SURVEY DESCRIPTION**

**PART OF THE SE QUARTER OF SECTION 10  
WORTHINGTON TOWNSHIP  
RICHLAND COUNTY, OHIO**

~~Situated in the Township of Worthington, County of Richland, State of Ohio and being a part of the Southeast Quarter of Section 10, of Township 21 North, Range 17 West, and being more particularly described as follows:~~

~~Commencing at an iron pin found and accepted as marking the northeast corner of said quarter section; Thence, South 00 degrees 31 minutes 36 seconds East with the east line of said quarter section, a distance of 967.76 feet to an iron pin found, said iron pin being the south east corner of a parcel currently owned by The First Congressional Church of Mansfield (deed reference: D.V. 560, Page: 280) the place of beginning of the herein described parcel;~~

~~Thence, continuing South 00 degrees 31 minutes 36 seconds East with said east line, a distance of 60.02 feet to an iron pin set;~~

~~Thence, North 88 degrees 56 minutes 36 seconds West passing through an iron pin set for reference at 1484.88 feet, a total distance of 1514.88 feet to a railroad spike set in the centerline of Bunker Hill Road (C.H. 108);~~

~~Thence, North 27 degrees 55 minutes 14 seconds West with said centerline, a distance of 68.59 feet to a railroad spike found and accepted as marking the southwest corner of said church parcel;~~

~~Thence, South 88 degrees 56 minutes 36 seconds East passing through an iron pin found for reference at 30.00 feet, a total of 1546.45 feet to the place of beginning containing 2.11 acres according to survey by Chad F. Craig, P.S. #8195 for Seiler and Craig Surveying, Inc. on March 23, 2007.~~


~~Iron pins set are 5/8" rods with caps stamped "SEILER AND CRAIG INC".~~

~~Bearings are based on an assumed meridian and intended to be used for angular determination only.~~

~~The grantees, his heirs and assigns do hereby covenant and agree that the parcel of land described in this instrument or any portion thereof does not constitute a principal building site and will not be conveyed by said grantees, heirs and assigns independent and separate from any adjoining or contiguous parcel fronting on a public highway or street.~~

NEW SPLIT  
RICHLAND COUNTY  
TAX MAP OFFICE  
MAB 3-26-07  
INITIAL DATE

Replaced By Y-258

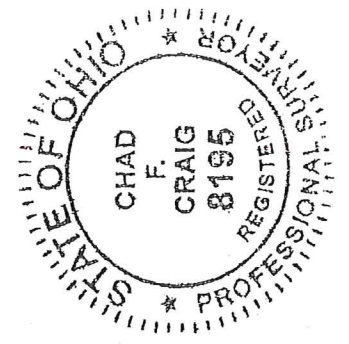

*Chad F. Craig*

Chad F. Craig P.S.#8195  
for Seiler & Craig Surveying, Inc.